

Manhole Inspection Summary

Manhole # S37AA_020MH

Printed On: 3/9/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **37AA** Node: **020** Status: **Found**

Insp Date: **11/20/08 11:00 AM**

Incomplete Comments

Crew: **cb**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **cross from 540 e monument st**

Cross Street: **forrest st**

Manhole Type: **Terminal**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **4** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **4** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☒ **Cracks** ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick and Concrete** ☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☐ Exists Material:

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **6** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S37AA_020MH


Printed On: 3/9/2009

Page 2 of 4

Location View



Top View

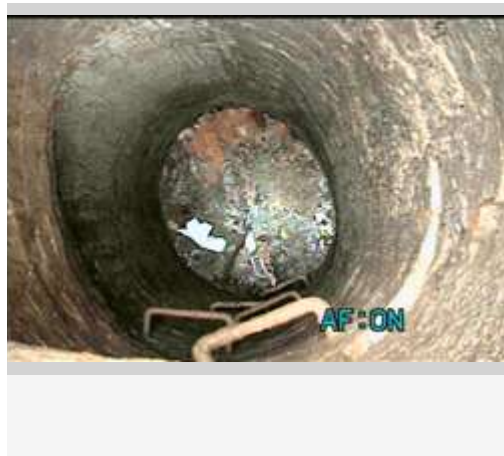

Defect 5



channel debris

Defect 4



cracked corbel, signs of infiltration

Defect 3



chimney cracked and deteriorated,
infiltration, frame adj

Defect 2



corr steps

Defect 1



offset

Manhole Inspection Summary


Manhole # S37AA_020MH

Printed On: 3/9/2009

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow

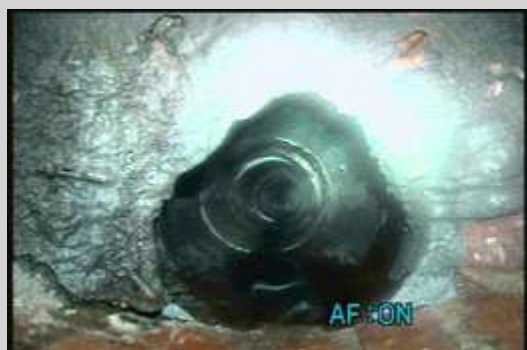

Pipe Height: **0** (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.25** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection